Technical Information

Aug 19, 2025

ROTEL YModem Upgrade Manager V2.0.3 Software Upgrade Instructions

Software update for Rotel products can be completed using the Rotel YModem software update utility via an UART connection. The step-by-step instructions below provide information on setup and configuration using a Windows PC.

Items needed for upgrade

- 1. Windows-compatible x86 or x64 PC with serial port connection, or USB-to-serial adapter.
- 2. TTL (+3.3V) straight cable with 3.5mm TRS connector (TX, RX, GND).



- 3. Upgrade software and YModem download program.
- 4. Supported operating system: Windows XP, Windows Vista, Windows 7, Windows 10


Note - Windows XP requires <u>installation of .NET framework</u> before installing the Rotel YModem software application.

Upgrade Procedure

 Download YModem Upgrade Manager V2.0.3 from ROTEL website. http://www.rotel.com/software-downloads




- 2. Connect the USB-to-UART cable between the unit and the computer.
- 3. Launch the Rotel YModem Upgrade Manager computer program. It should be located in the folder labeled "Rotel YModem Upgrade Manager".

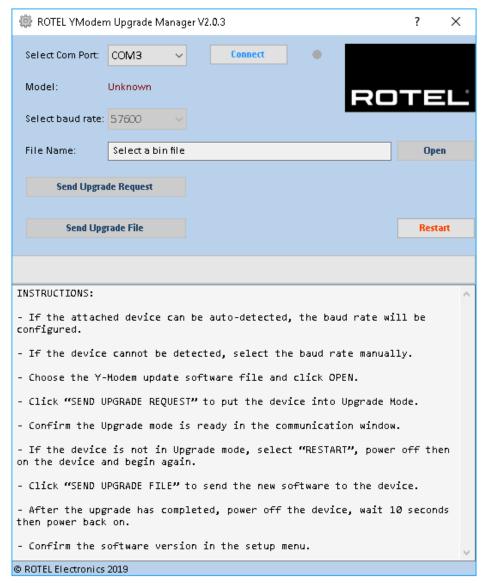


4. Once the YModem program has launched, verify or adjust the settings to the following: Port: COM3 (or the appropriate COM port for your PC's serial connection – see the Troubleshooting section at the end of this document for more information on determining the correct COM port)


5. Press "Connect" on the program. The Connect button should grey out, and the Open button should become selectable.

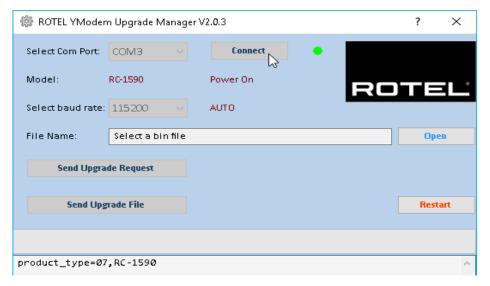


6. Click the "Open" button. A window will open to locate the software update bin file which was included with the upgrade files. Browse to the location on the computer where this file was saved, select the file and click [Open] for next step.

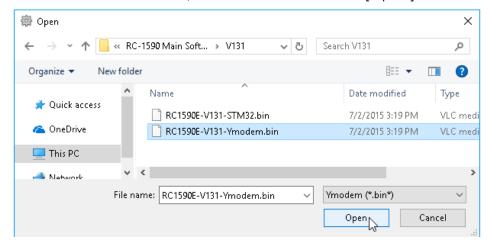


7. Once the file has been selected, click the "Send Upgrade Request" button.

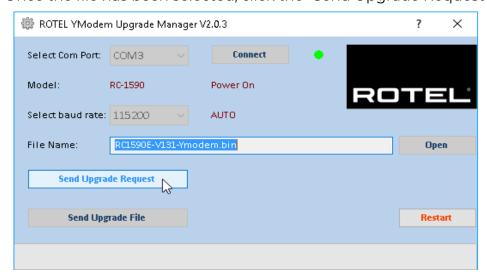


8. The front panel display of the unit should turn off and some text should appear in the window of the Ymodem program.

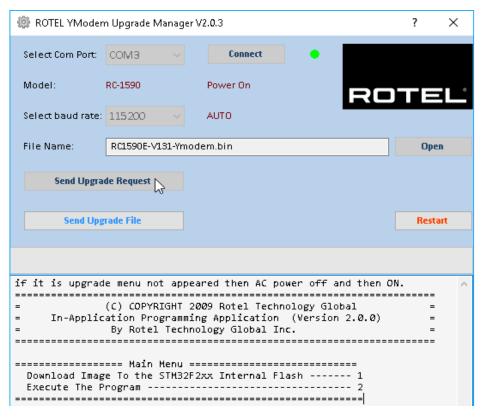

- 9. Click the Send Upgrade File" button to start the download. A file transfer window should appear as the file downloads to the unit.
- 10. Once the transfer is complete the file transfer window will disappear, and the text in the file transfer window will indicate the programming has completed and to turn power cycle the device.

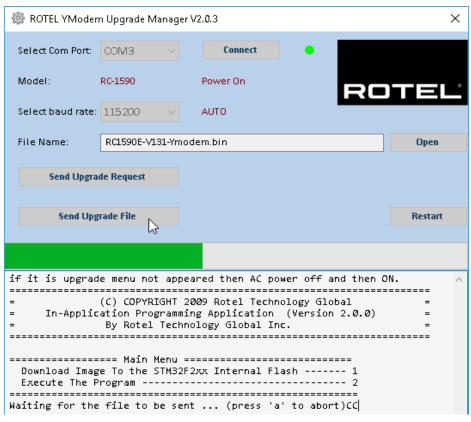

11. Press "OK" to close the file transfer window, and then press "Close" to close the YModem Upgrade Manager.

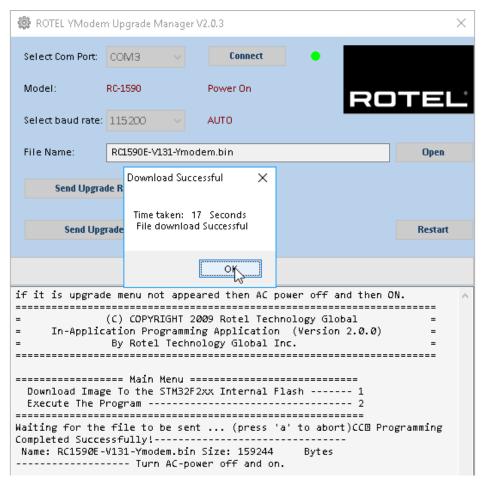

- 12. Unplug the power cord, or push the front panel power toggle button to do a power cycle to complete the upgrade process.
- 13. If at any time the update is interrupted or failed, or the unit does not respond after upgrade see the Troubleshooting section at the end of this document to try the procedure again.

Troubleshooting

 How to determine COM port: It is important when selecting the com port for updates and UART communication to be aware of what com port is being used on the PC for the upgrade, whether it be a built in serial port on the PC, or a USB to serial adapter. Selecting the incorrect com port in an update program or an UART terminal will result in communication errors.

Common YModem error messages from incorrect com port settings are:


"Unable to connect. Please verify COM port information."

This error appears when selecting a com port that does not exist on the PC, or when the currently selected com port is in use by another program or device.


Solution: Refer to the steps below for information on how to determine which com port the serial port is on, and how to change it if necessary. If the port is correct, close all open programs. Common programs that also use the serial port would be other terminal programs like HyperTerminal.

Use the following steps to confirm which com port the serial port or USB to Serial adapter has been installed to and if necessary, change it to a more suitable port.


- 1. From the desktop, right click on "My Computer", and select Properties.
- 2. From the System Properties window, click on the Hardware tab, and select Device Manager.
- 3. From the Device Manager Window, look for the setting labeled Ports (COM & LPT), and click on the + to open this section. The USB to Serial adapter should be listed in this area, with the COM port in use listed in parenthesis next to it.

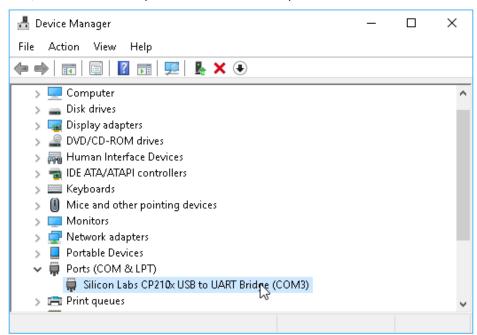


- Unable to Lunch on Windows 7/10: By default, Windows 7/10 has integrated .Net Framework 2.0/3.5 inside and user no need to manually install it, please check below configuration to make sure it is enabled in Windows 7 and 10 if unable to lunch the application
 - 1. Press [WIN]+[R] keyboard shortcut to activate RUN dialog box, type "appwiz.cpl" to lunch "Programs and Features".

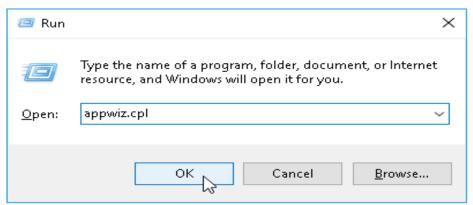

2. Click "Turn Windows features on or off" to activate "Windows Features" dialog box.

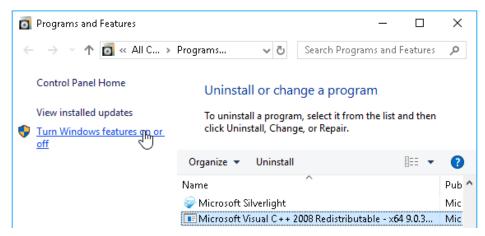

3. Make sure below ".NET Framework 3.5" option is enabled.

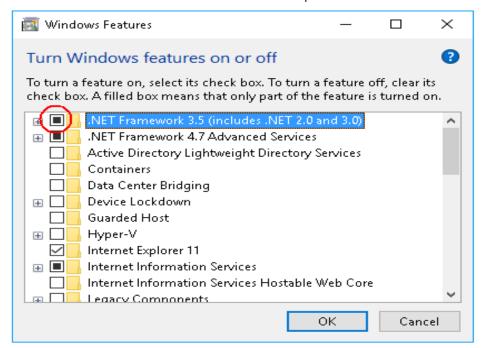

 Failed to Receive the File during upgrading: Generally, the upgrading requires a good UART communication, make sure a good enough UART or USB cable be used, a long external UART or USB cable possible led a bad electrical signal quality transferring during upgrading process.


Check below options when you see below error message:

- 1. Check the UART or USB connection.
- 2. Check the USB-to-UART convertor, or replace it by good one.
- 3. Remove the UART or USB external cable to shorter the distance between amplifier and main chassis of the PC computer, or replace by a good one.



- Important for Windows XP: make sure you have the .NET FRAMEWORK 2.0/3.5 installed, in addition make sure you have the Windows Installer 3.1 installed before you installed the framework.
 - 1. Access below link to download and install .Net Framework 2.0/3.5: https://www.microsoft.com/en-US/download/details.aspx?id=21

To download the full redistributable package, rather than the bootstrapper, click on the link below to start the download: <u>.NET Framework 3.5 full package</u>

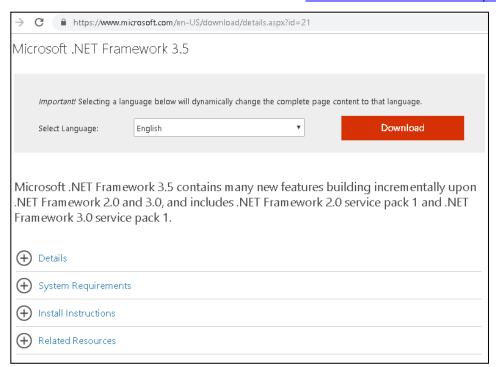

2. Access below link to download and install Windows Installer 3.1: http://support.microsoft.com/kb/893803